



LTM-IMK INSTALLATION INSTRUCTIONS FOR FORD EXPLORER/INTERCEPTER MOUNTING KIT

INSTALLATION STEPS:

- Drill a 7/8" hole through the Ford Explorer roof directly in the center of two ribs.
- Peel paper off the 1/2" gasket to expose the adhesive. Center the gasket on the hole with the adhesive facing down and the flat edges parallel to the ribs.

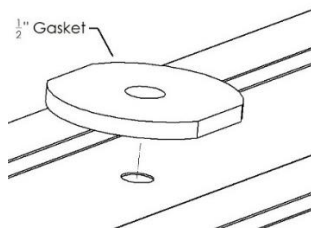

- **IMPORTANT:** Before installing antenna, place two O-Rings over the LTM stud. The O-Rings will stay in place during installation. Make sure the O-Rings are flat against the gasket and each other.

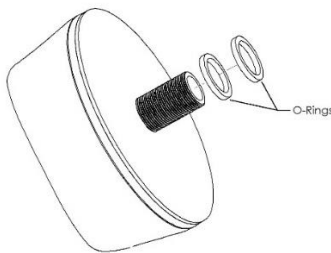

Exploded view of Mounting Kit

- Remove all the paper from the gaskets.
- OPTIONAL: If additional sealing is required, a bead of silicone can be applied to the top of the 1/2" gasket as well as around the O-Rings.
- Feed the cables through the 1/2" gasket and the roof. Attach nut from the inside.
- Tighten nut to 5 lb./ft. (6.8 Nm).
NOTE: DO NOT overtighten

WARRANTY

Mobile Mark, Inc. (Seller) warrants to Buyer that the products for a period of two years from the date of shipment will be free from defects of material and workmanship, and will be in accordance with specifications referred to herein. Seller's sole obligation under these warranties will be limited to either, at Seller's option and expense, repairing, or furnishing a replacement F.O.B. First point of shipment for the products or parts thereof which Seller reasonably determines do not conform with these warranties, and Buyer's exclusive remedy for breach of any of such warranties will be enforcement of such obligations of Seller. THE FOREGOING WARRANTIES ARE EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES OF MERCHANTABILITY, FITNESS FOR PURPOSE AND OF ANY OTHER TYPE, WHETHER EXPRESS OR IMPLIED. IN NO EVENT SHALL SELLER BE LIABLE FOR CONSEQUENTIAL DAMAGES, nor shall Seller's liability on any claims for damages arising out of or connected with the sales contract for the manufacture, sale, delivery or use of the products exceed the purchase price of the products. Any action for breach of warranty must be commenced within one year after the cause of action accrues.

1140 W. Thorndale Ave. • Itasca, IL 60143, USA
Toll free: 1-800-648-2800 (US & Canada) • Phone: 1-847-671-6690 • Fax 847-250-5120
www.mobilemark.com